
SPECPROTM SET-UP AND MAINTENANCE

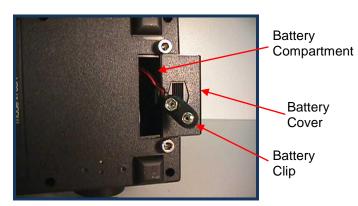

Step 1: Power SpecPro[™] with either its AC adapter or a 9 volt battery. WARNING: USE ONLY THE AC ADAPTER SUPPLIED BY KRELL.

Platen Liner Bearing Hole Locking Handle Drive Bearing Base Liner

Step 2: Place platen on base plate making sure it sits upon the drive bearing


FOR SAFE OPERATION

- Use only Krell AC adapter
- Keep hands away from all moving parts
- Do not use excessive water during operation
- Do not operate with loose clothing, ties, jewelry, etc.

TO STOP POLISHER, DEPRESS THE POWER SWITCH


MAINTENANCE

- Always disconnect AC adapter during maintenance
- Replace platen and base liners approximately every 200 hours of operation
- Keep all surfaces dry and clean between polishing sessions
- Clean connector positions with supplied brush

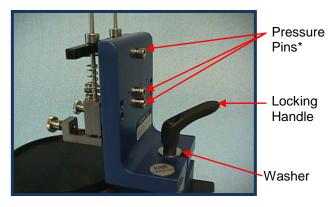

Step 3: Engage workholder with base post. Make sure the washer sits between locking handle and workholder. Align workholder square with polisher and lock.

*New generation SpecPros use pairs of pins to maintain pressure. Upper Pin

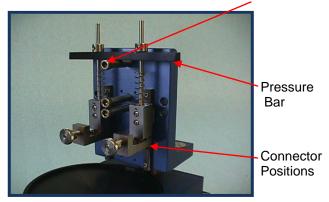

Step 4: Lift connector positions upward using the pressure bar. Slide upper pin beneath bar to hold.

Dial Timer



Power and Emergency Stop Switch

krell technologies www.krelltech.com Tech Support: 732-775-7355